

VEHICLE SAFETY RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	2698	DATE	January 27, 2011.
MANUFACTURER	SUZUKI MOTOR CORPORATION		
DESCRIPTION OF DEFECT	<p>The tension adjuster pulley is for the drive belt that operates the generator, water pump, air conditioner compressor, and power steering pump. As internal spring of the belt tension adjuster was manufactured improperly, the spring may be broken and the tension of the belt will not be adjusted. When the tension became weak, noise will be appeared. If the weakened tension adjuster is continuously used as it is, the belt will be slipped and the generator and water pump pulleys will not be worked. Then, warning lamps for buttery charge and water temperature come on. In the worst case, the belt may come out from power steering pump pulley and driver will need increased effort to steer the vehicle.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
CAB-TDA4W	Escudo	2008 to 2010	7,517
		TOTAL	7,517