

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN NO.	2790	DATE	July 28, 2011
MANUFACTURER	AICHI Corporation		
DESCRIPTION OF DEFECT	<p>On the mounting of the aerial platform, in some cases, the positions of plug welding are located close to the edge of the chassis-frame-flange due to the in-correct shape of chassis spacers.</p> <p>Therefore, when setting the outrigger in order to conduct aerial works, the weight of the cabin and other components is imposed to the chassis frame, and repetition of the above mentioned work cracks the chassis frame, and then when the machine is used with such condition, the crack progresses, and in the worst case, there is a possibility of breaking the chassis frame.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
U-NKR66EPN KC-NKR66EP	ELF	1993- 1997	1,625
KC-AKR66EP	ATLAS	1995-1996	141
KC-BKR66EP	CONDOR	1996	1
TOTAL			1,767