

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	GAI-1767	DATE	July 28, 2011
MANUFACTURE	Caterpillar UK LTD (Caterpillar Japan LTD)		
DESCRIPTION OF DEFECT	<p>Due to inadequate margin for durability of diaphragm used for boost controller on fuel injection pump, it may break, output power may decrease, excessive black smoke may occur and fuel may mix with engine oil if it is kept in using. And in the worst case, fuel may pass into combustion chamber through broken diaphragm &amp; inlet manifold and engine speed may excessively increase, which may result the machine uncontrolled.</p> <p>Therefore it is necessary to replace with new injection pump of which boost controller diaphragm durability is adequate.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
9WM	914G	1995~2002	314
TOTAL			314

Note: