

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN NO.	2792	DATE	August 2 ,2011
MANUFACTURER		ISUZU MOTORS LIMITED	
DESCRIPTION OF DEFECT		<p>In the tractors equipped with the Diesel Particulate Defuser (DPD), it has been found that the configuration of heat shield plates on the tractors was inadequately designed. If the affected tractors receive strong winds from their right rear side during the regeneration of the DPD, exhaust gases will be put onto the relay box, so that the box may be melted by heat. If the affected tractors are used as they are, rainwater, etc., will intrude into the relay box, and electric parts inside the box will be corroded, thereby causing poor continuity. If it occurs, there is a possibility that, in the worst case, the engine stalls and/or the lamps malfunction.</p>	

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
PDG-EXD52D8 PKG-EXD52D8	GIGA	2007-2009	1,412	
PDG-EXD52E8 PKG-EXD52E8		2007-2009	278	
PDG-EXD52G8 PKG-EXD52G8		2007-2009	154	
PDG-EXD52L8 PKG-EXD52L8		2007-2009	29	
PDG-EXR52D8 PKG-EXR52D8		2007-2009	26	
PDG-EXR52E8		2007	1	
PDG-EXR52G8 PKG-EXR52G8		2007-2008	16	
		TOTAL	1,916	