Form No. 4: Summary of Recall Campaign in English (Related to Article 2)

			Import Vehicles		
Campaign No.	Gai-1800	Date	December, 2, 2011		
Manufacturer	Jaguar Cars Limited Japanese Importer: Jaguar Land Rover Japan Limited				
Description of defect	A concern has been identified with 2010 and Model Year XK and XF vehicles whereby the Power Assisted Steering (PAS) pipes have been supplied with zinc-nickel plating that does not meet fully the corrosion protection requirements of Jaguar's engineering specification.				
	After an extended period of time in service, corrosion of the PAS pipes will occur, this may lead to pin-holing of the pipe. Pin-holing of PAS pipes could allow pressurized PAS fluid to leak into the under- hood and engine bay area. Loss of PAS fluid will cause PAS system noise and loss of power assisted steering; steering control is fully maintained in an unassisted state. It is also possible that the PAS fluid may ignite if it comes into contact with an ignition source or a surface at sufficiently high enough temperature.				

Туре	Commercial name	Model year	recalled	Number of vehicles
CBA-J05FA	XF 3.0	2009 - 2010		219
CBA-J05LB	XF Premium Luxury	2009 - 2010		9
CBA-J05MB	XFR	2009 - 2010		25
CBA-J438B	XK Coupe / Convertible	2009 - 2010		12
CBA-J43YB	XKR Coupe / Convertible	2009 - 2010		19
			Total	284

(JIS A4 size)