

Form No. 4: Summary of Recall Campaign in English (Related to Article 2)

Vehicle Safety/Pollution Recall Campaign in Japan

Import Vehicles

Campaign No.	Gai-1809	Date	January, 13, 2012
Manufacturer	Jaguar Cars Limited Japanese Importer: Jaguar Land Rover Japan Limited		
Description of defect	<p>There have been reports of reduced performance in the headlamp beam range and of being unable to adjust the headlamp aim. Investigation has shown that the plastic headlamp adjuster link piece of the vertical adjuster mechanism was breaking on a number of vehicles, generally at around 36 months in service.</p> <p><u>S-Type</u> – Once the adjuster link is broken, the lamp reflector/projector is no longer correctly located inside the lamp and the aim cannot be adjusted. Since the link controls the vertical adjustment the resultant headlamp beam pattern may be slightly lowered and produce reduced headlamp range performance.</p> <p><u>X-Type</u> - Once the adjuster link is broken, the lamp reflector/projector is no longer correctly located inside the lamp and the aim cannot be adjusted, the driver may experience a fluttering headlamp beam whilst driving, due to the reflector not being rigidly located within the lamp.</p>		

Type	Commercial name	Model year recalled	Number of vehicles
GH-J51YA	X-TYPE 2.0 V6	2001.25 - 2008	3,874
ABA-J51YB	X-TYPE 2.0 V6 Estate		2,411
GH-J51XA	X-TYPE 2.5 V6	2001.25 – 2008	3,463
ABA-J51XB	X-TYPE 2.5 V6 SE		767
	X-TYPE 2.5 V6 Sport X-TYPE 2.5 V6 Estate		
GH-J51WA	X-TYPE 3.0 V6 SE	2001.25 - 2008	1,544
ABA-J51WB	X-TYPE 3.0 V6 SE		148
	X-TYPE 3.0 V6 Sport X-TYPE 3.0 V6 Sovereign		
GH-J01JC	S-TYPE 2.5 V6	2002.5 - 2008	1,672
GH-J01FC	S-TYPE 3.0 V6	2002.5 - 2008	1,574
CBA-J01FD			1,006
GH-J01HC	S-TYPE 4.2 V8	2002.5 - 2008	197
CBA-J01HD			53
GH-J011C	S-TYPE R	2002.5 - 2008	208
CBA-J011D			30
		Total	16,947

(JIS A4 size)