

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN NO.	2898	DATE	February 28 ,2012
MANUFACTURER	ISUZU MOTORS LIMITED		
DESCRIPTION OF DEFECT	<p>(1) In the glide-slide type door of a route bus, some rotating shafts of the door shafts are eccentric. Therefore, if the door is opened and closed repeatedly with the shaft of such condition, lubrication in the ball joint of the door arm becomes insufficient. And then, the ball joint may have a seizure and in the worst case, the door could not be opened or closed.</p> <p>(2) In the external switch for opening and closing the door of a route bus, some connections of the switch wiring are improperly water-proofed and thus allow water into the wiring. As such, if the switch is used continuously in this condition, the wiring might corrode and disconnect and in the worst case, it could be impossible to open and close the door with the external switch and the switch on the driver seat for opening and closing the door.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
PJ-LV234L1	ERGA	2007	91
PDG-LV234L2		2007-2010	774
PKG-LV234L2		2010-2011	64
LDG-LV234L3			
LKG-LV234L3		2007	50
PJ-LV234N1		2007-2010	364
PDG-LV234N2		2010-2011	47
PKG-LV234N2			
LDG-LV234N3			
LKG-LV234N3			
		TOTAL	1,390