VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN



| CAMPAIGN No. | 2906 | DATE | March 14.2012 | | | |
|-----------------------|--|------|---------------|--|--|--|
| MANUFACTURER | YANMAR CO.,LTD. | | | | | |
| DESCRIPTION OF DEFECT | In power steering cylinder of steering device, paint film on cylinder rod's edge is squashed when tierod's locknut is clenched, due to its thick paint. Using under this condition, loose locknut which gradually lost power to tighten can allow tierod-end to come off, and may lead handling steer disabled. | | | | | |

| TYPE | COMMERCIAL NAME | MODEL YEAR RECALLED | NUMBER OF VEHICLE | | |
|----------|--------------------|------------------------|----------------------|-------|------|
| SA-28FA | EF326V | 2005~2008 | 914 | | |
| | EF328V | 2005~2008 | 649 | | |
| EDM-28FC | EF326V | 2008 | 47 | | |
| | EF328V | 2008 | 44 | | |
| SA-34FA | EF330V | 2005~2008 | 1716 | | |
| | EF334V | 2005~2008 | 1500 | | |
| EDM-34FF | EF330V | 2008 | 189 | | |
| | EF334V | 2008 | 164 | | |
| SA-42FA | EF338V | 2005~2008 | 725 | | |
| | EF342V | 2005~2008 | 632 | | |
| EDM-42FB | EF338V | 2008 | 80 | | |
| | EF342V | 2008 | 87 | | |
| | | _ | | TOTAL | 6747 |