

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

~~Domestic~~ / Import Vehicles

CAMPAIGN No.	Gai-1828	DATE	11/Apr/2012
MANUFACTURER	Automobiles Volvo Car Corporation (Japanese Importer: Volvo Cars Japan Limited)		
DESCRIPTION OF  DEFECT	<p>Volvo Car Corporation (VCC) has decided to carry out a safety recall on a limited number of Volvo S60, V60, XC60, S80, V70, XC70 vehicles (model year 2012), equipped with an audio- and/or back-up camera amplifier under either the left front or the right front seat.</p> <p>VCC investigations have identified that the wire harness under the driver and or passenger seat may not have been properly affixed to the seat frame during vehicle assembly. As such, the harness may get caught by the audio- and or back-up camera amplifier (mounted under either of both the seats) when the seating position is adjusted. If this occurs, the harness connector may detach from the socket and, as a result, the airbags may not function as intended, causing the instrument panel SRS warning lamp to illuminate. A message to the driver in the Driver Information Module (DIM) will indicate: "SRS service required urgent". Failure of a frontal or side airbag to deploy as intended during a crash (where deployment is warranted) could increase the risk of personal injury to the seat occupant, hence the item is considered to be an unreasonable risk to motor vehicle safety. If the SRS warning lamp and the "SRS service required urgent" message are not present in the driver information module, the airbags will be fully functioning, although, until you have visited the retailer for inspection and repair if needed, it is recommended to refrain from adjusting the front seats .</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
VOLVO	S80	2012	17
	S60	2012	1,175
	V70	2012	364
	XC70	2012	50
	V60	2012	1,772
	XC60	2012	547
		TOTAL	3,925