

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

~~Domestic~~/Import Vehicles

CAMPAIGN No.	G A I - 1 8 7 0		DATE	September 25, 2012
MANUFACTURER	ISEKI & CO., LTD.			
DESCRIPTION OF DEFECT	<p>The radiator fan shroud gets breakage due to vibration from engine or stress by wind pressure which radiator fan makes, because the material of shroud does not have enough strength against the stress.</p> <p>Such kind of breakage may cause serious leakage of coolant from radiator due to stick of tip of broken shroud to radiator. In the worst case, the leakage may cause overheating of engine under continuance operation of these tractors.</p>			
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
F003	T7145	2004—2005	10	
	T7145V	2004	10	
	T7160	2003—2006	8	
	T7160V	2004	3	
F004	T7175	2003—2006	11	
	T7175V	2004—2005	17	
EDR-T158F	T8175D	2007—2008	3	
	T8175V	2007—2010	8	
JDS-T158F	T8200D	2007—2008	2	
	T8200V	2007—2010	13	
			TOTAL	85