

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-1866	DATE	Sep. 07, 2012
MANUFACTURER	PLOT USA INC. (Japanese Importer: PLOT INC)		
DESCRIPTION OF DEFECT	<p>Unsuitable rubber materials are used for fuel hose, and some fuel hoses and joint parts are not assembled properly because some parts are not considered perfectly when designing a swage part (socket) for injection model produced by Plot.</p> <p>With this condition, when hose loses elasticity due to using unsuitable rubber materials, swage (socket) becomes loose and it leads to fuel leakage.</p> <p>The worst thing that can happen is vehicle fire.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DRA	ROAD HOPPER	2009-2011	68
FH3		2010-2011	3
HR3		2010-2012	23
PRC		2011-2012	27
		TOTAL	121