VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN



CAMPAIGN No.	3048	DATE	Oct 31,2012	
MANUFACTURER	KYOKUTO KAIHATSU KOGYO CO., LTD.			
DESCRIPTION OF DEFECT	On trailer axle, since the wire attachment position of the equipment (catch strap) limiting the stretch and the height of air suspension is unsuitable, the wire can touch the axle. Therefore, if the trailer continues to be used in such condition, the part of axle touching the wire will wear away and the strength of the axle may be damaged.			

ТҮРЕ	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
KL24-17LS	tank semi-trailer	2008-2009	10
KL26-37LC	tank semi-trailer	2008	3
KL24-47LC	tank semi-trailer	2007-2008	2
KL24-17LC	tank semi-trailer	2008	2
KTT280改	tank semi-trailer	2009	2
KL24-47LC1	tank semi-trailer	2010	1
KL24-46LC	tank semi-trailer	2007	1
		TOTAL	21