

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN No.	3074	DATE	Dec.11.2012
MANUFACTURER	Hino Motors, Ltd.		
DESCRIPTION OF DEFECT	<p>The bolts that fastened the earth cable terminal became loose in the battery earth circuit for a route bus as the earth cable terminal had not been firmly fixed to the bus body due to the manufacturing problems mentioned below. This may cause a contact failure, and the battery power supply may be cut, and at worst, this could lead to engine stop, and closing the open passenger door.</p> <p>The manufacturing problems include:</p> <p>(1)Waterproof seal was between the earth cable terminal and bus body.</p> <p>(2)Antirust wax was between the earth cable terminal and bus body.</p> <p>(3)The bolt nuts moved off the center of the bolt holes on the bus body, and the bolt threads interfered with the bus body.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
LDG-KV234L3	HINO Blue Ribbon II	2010～2012	224
LDG-KV234L3KAI			
LKG-KV234L3			
QDG-KV234L3			
QDG-KV234L3KAI			
QKG-KV234L3			
QPG-KV234L3			
LDG-KV234N3		2010～2012	308
LDG-KV234N3KAI			
LKG-KV234N3			
LKG-KV234N3KAI			
QKG-KV234N3			
QKG-KV234N3KAI			
QPG-KV234N3			
QPG-KV234N3KAI		2010～2012	100
LDG-KV234Q3			
LDG-KV234Q3KAI			
LKG-KV234Q3			
LKG-KV234Q3KAI			
QDG-KV234Q3			
QDG-KV234Q3KAI			
QKG-KV234Q3	HINO Rainbow II	2011～2012	84
QPG-KV234Q3			
SDG-KR290J1		TOTAL	716