

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN NO.	3073	DATE	December 11 ,2012
MANUFACTURER	ISUZU MOTORS LIMITED		
DESCRIPTION OF DEFECT	<p>The bolts that fastened the earth cable terminal became loose in the battery earth circuit for a route bus as the earth cable terminal had not been firmly fixed to the bus body due to the manufacturing problems mentioned below. This may cause a contact failure, and the battery power supply may be cut, and at worst, this could lead to engine stop, and closing the open passenger door.</p> <p>The manufacturing problems include:</p> <p>(1)Waterproof seal was between the earth cable terminal and bus body.</p> <p>(2)Antirust wax was between the earth cable terminal and bus body.</p> <p>(3)The bolt nuts moved off the center of the bolt holes on the bus body, and the bolt threads interfered with the bus body.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
LDG-LV234L3 LDG-LV234L3(kai) LKG-LV234L3 QDG-LV234L3 QKG-LV234L3 QPG-LV234L3 OOG-LV234L3	ERGA	2010-2012	384
LDG-LV234N3 LDG-LV234N3(kai) LKG-LV234N3 QDG-LV234N3(kai) QKG-LV234N3 OPG-LV234N3		2010-2012	430
LDG-LV234Q3 LKG-LV234Q3 QDG-LV234Q3 QKG-LV234Q3 OPG-LV234Q3		2010-2012	98
SDG-LR290J1	ERGA MIO	2011-2012	125
TOTAL			1,037