

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3109	DATE	Feb. 21 2013
MUNUFACTURER	Mitsubishi Fuso Truck and Bus Corporation		
DESCRIPTION OF DEFECT	On some heavy-duty route buses, the material of a rubber part used in the starter is improper and the margin for wear of the flywheel ring gear is insufficient. Because of these causes, if the engine is started frequently by the idling stop and start system, the ring gear may wear prematurely. If the vehicle continues to be used in this condition, the starter gear will start to slip and, in the worst case, it will become impossible to start the engine.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
LKG-MP35FK	「FUSO AERO STAR」	2010 ~ 2012	31	
LKG-MP35FM		2010 ~ 2012	245	
LKG-MP35FP		2010 ~ 2012	81	
LKG-MP37FK		2010 ~ 2012	432	
LKG-MP37FM		2010 ~ 2012	93	
QDG-MP35FM		2012 ~ 2012	7	
QDG-MP35FP		2012 ~ 2012	8	
QKG-MP35FK		2012 ~ 2012	11	
QKG-MP35FM		2012 ~ 2013	88	
QKG-MP35FP		2012 ~ 2012	65	
QKG-MP37FK		2012 ~ 2012	148	
QKG-MP37FM		2012 ~ 2012	47	
LKG-AP35FK		「SPACERUNNER A」	2011 ~ 2011	2
LKG-AP35FM			2010 ~ 2011	20
LKG-AP35FP	2010 ~ 2011		3	
LKG-AP37FK	2010 ~ 2011		24	
LKG-AP37FM	2010 ~ 2010		5	
		TOTAL	1,310	