

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	GAI-1915	DATE	March. 14. 2013
MANUFACTURER	HONDA CANADA INC.		
DESCRIPTION OF DEFECT	<p>With regard to vehicle stability assist (VSA) system, when the electronic circuit board and capacitor within the control unit were heat-bonded, a gap may have been left in the negative terminal bonding area in the capacitor. Should electrolytic corrosion through such a gap and resultant oxide film build up, electric noise that may be produced due to voltage fluctuation could not be eliminated and the sensor to detect brake pedal travel could be thereby activated erroneously. Should this happen, unintended brake assist would be given and, in the very worst case, the vehicle could be braked suddenly with its brake lights remaining off.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
CBA-YD1	「MDX」	2004~2005	179
		TOTAL	179