

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3119	DATE	March. 14. 2013
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>With regard to vehicle stability assist (VSA) system, when the electronic circuit board and capacitor within the control unit were heat-bonded, a gap may have been left in the negative terminal bonding area in the capacitor. Should electrolytic corrosion through such a gap and resultant oxide film build up, electric noise that may be produced due to voltage fluctuation could not be eliminated and the sensor to detect brake pedal travel could be thereby activated erroneously. Should this happen, unintended brake assist would be given and, in the very worst case, the vehicle could be braked suddenly with its brake lights remaining off.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ABA-RB1	「ODYSSEY」	2004	15,203
		2004～2005	21,735
ABA-RB2		2004	2,154
		2004～2005	3,474
DBA-RR3	「ELYSION」	2004～2005	3,484
		2004～2005	18
DBA-RR4		2004～2005	861
DBA-RG1	「STEPWGN」	2005～2006	1,229
DBA-RG2		2005～2006	511
DBA-RG3		2005～2006	1,780
DBA-RG4		2005～2006	526
DBA-KB1	「LEGEND」	2004～2006	5,864
		TOTAL	56,839