

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3122	DATE	March, 27, 2013
MANUFACTURER	KUBOTA Corporation		
DESCRIPTION OF DEFECT	<p>(1)The springs of the side clutch valve are not durable enough. They may be broken after certain hours operation, and the broken part makes the side clutch valve stick. It leads the malfunction of turning operation.</p> <p>(2)The fixing bolt of the steering lever is not machined adequate. That is too thin and may be broken. That makes the malfunction of turning operation.</p> <p>(3)The range shiift gear is not right material and not durable enough. It may be broken after certain hours operation and makes the driving problem.</p>		
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
EDM-C427	「ER447」	2009～2012	1,629
EDM-C428	「ER438」	2009～2012	647
EDM-C326	「ER335」	2009～2012	715
	「ER329」	2009～2012	2,259
C320	「ER323」	2012	180
	「ER320」	2012	188
C235	「ER220」	2012	142
C234	「ER217」	2012	126
	「ER215」	2012	251
		TOTAL	6,137