

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN No.	3196	DATE	Jul.30.2013
MANUFACTURER	Hino Motors, Ltd.		
DESCRIPTION OF DEFECT	In the route buses, it has been found that the compressor vane wheel lacked in strength against variations of turbo charger revolution. When the engine is operated repeatedly using high-speed range at the time when the buses are started, the compressor vane wheel may be damaged. If it is used as is, white smoke and output shortage will cause, thereby rendering the buses inoperative.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
PJ-KV234L1	[HINO Blue Ribbon II]	2005	2
PJ-KV234N1		2007	1
		TOTAL	3