

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3243	DATE	October.17. 2013
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	Concerning the water pump pulley and the flange to which the pulley is tightened, the distance between the end of the flange and the inward bend of the pulley may be shorter than specified. In this case, the flange may, after the pulley is tightened to it, get on the inward bend of the pulley, causing a gap. Through repetition of loading imposed by the serpentine belt, the inward bend of the pulley can get worn, causing the tightening bolt to come loose. Should the bolt break off and cause the serpentine belt to come off the pulley, the vehicle's electric power generating function and cooling function could be impaired or lost, when the warning light would come on and the engine would stall and refuse to restart.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-RK1	STEPWGN	2010~2011	4,789
		2010~2011	12
		2009~2010	2
DBA-RK3		2011	12
DBA-RK5	STEPWGN SPADA	2010~2011	7,820
		2011	13
		2010	2
DBA-RK7		2010~2011	18
DBA-RN8	STREAM	2010~2011	351
		TOTAL	13,019