

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/~~Import~~ Vehicles

CAMPAIGN No.	3264	DATE	November 29, 2013
MANUFACTURE	TOYOTA INDUSTRIES CORPORATION		
DESCRIPTION OF DEFECT	<p>In some of the electronic fork lift vehicles, there is a possibility that a contact resistance of a terminal crimping in battery plug may increase because the terminal crimping is not proper, which may enlarge heat generation of the battery plug terminal under heavily-loaded operation.</p> <p>If the vehicle has been kept using with this condition, heat generated by a continuous heavily-loaded handling operation may deform the resin portion of the battery plug, which may possibly disconnect the battery with the vehicle electronic system, so that the vehicle may be shut down and enable to re-start.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
7FBL25	TOYOTA GENEIO B	2012	43
7FB25		2012	30
407FB25		2012	7
7FB45		2012	1
		TOTAL	81