

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3304	DATE	February. 13. 2014
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	For certain engines, incorrect rust inhibitor may have been applied to the sealing bolt for suppressing the rotation of the rocker-arm shaft. In this case, torque of the sealing bolt can be reduced by the heat of the engine, and as a consequence the sealing bolt can come loose and fall out. Should this happen, engine oil could leak out whilst in use and, in the very worst case, the rocker-arm shaft could be detached, causing the engine to stall while driving and refuse to restart.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
EBL-NC47	CBR400R 400X CB400F	2013	3,839
		TOTAL	3,839