

Vehicle Safety/Pollution Recall Campaign in Japan

Import Vehicles

Campaign No.	Gai – 2021	Date	April 18,2014
Manufacturer	Jaguar Land Rover Limited (Japanese Importer : Jaguar Land Rover Japan Limited)		
Description of defect	<p>The car configuration file is incorrectly set which results in the front indicator light diagnostics not working. The end result to the customer is that if the front indicator bulb fails, the customers will not be alerted to this via the instrument cluster. In the correct state, should a front indicator bulb fail, the direction indicator on the instrument cluster will flash at double speed to indicate failure of the direction indicator to the driver.</p> <p>The root cause is that the parameter within the car configuration file is incorrectly set to diagnose front direction indicator failure via a LIN message. The correct setting is to diagnose the fault via a hardwired connection to the direction indicator lamp. This incorrect setting means that the full diagnostic capabilities are not available.</p>		

Type	Commercial name	Model year recalled	Number of vehicles
ABA-LG3SB	「Range Rover」	2014	73
ABA-LG5SA	「Range Rover」	2014	12
Total			85