VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicle

CAMPAIGN No.	3356	DATE	May 16, 2014		
MANUFACTURER	KOBELCO CRANES CO.,LTD				
DESCRIPTION OF	DEFECT 1 (D-1)				
DEFECT	The bearing of input shaft in reduction unit of power divider may				
	contact with its installation cover due to inadequate clearance.				
	Continuously being used under this condition, the bearing would				
	be damaged and it may cause that the engine would stop by				
	fixing of input shaft in worst case.				
	DEFECT 2 (D-2)				
	For hydraulic plumbing clamp on power divider,				
	① It exists that the tightening torque of clamping bolt is				
	inadequate. This may cause looseness of bolt by vibration and				
	leakage of hydraulic oil in worst case when hydraulic plumbing				
	has cracked.				
	②It exists that the bending work of bracket is inadequate. This may cause crack of bracket by vibration and leakage of hydraulic oil in worst case when hydraulic plumbing has cracked.				

ТҮРЕ	COMMERCIAL	MOD	EL YEAR	NUMBER OF
	NAME	REC	ALLED	VEHICLE
JDS-EE02	RK250-7	200	8-2013	292 units
UDS-EE04		2013-2014		D-1: 292
	RK250-8			D-2 ①: 292 ②: 60
				28 units
				D-1: 28
				D-2 ①: 28 ②: 0
			TOTAL	320