

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic ~~Import Vehicles~~

CAMPAIGN No.	Gai-2035	DATE	May.22, 2014
MANUFACTURE	General Motors Company (YANASE GLOBAL MOTORS CO.,LTD.)		
DESCRIPTION OF DEFECT	General Motors has decided that a defect which relates to motor vehicle safety exists in some 2008-2009 and all 2010-2013 model year GMC Acadia vehicles. Corrosion and/or loose crimps in the driver and passenger seat mounted side impact airbag (SIAB) wiring harness connectors can cause an increase in resistance. The airbag sensing system will interpret an increase in resistance as a fault. A fault will illuminate the airbag readiness light on the instrument cluster and a "SERVICE AIR BAG" message in the Driver Information Center (DIC), and set a Diagnostic Trouble Code (DTC). At first, at lower levels of resistance, the light and DIC message may be intermittent and the airbags and pretensioners will still deploy. Over time, the resistance may reach a level where the SIABs, front center side airbag, if equipped, and pretensioners will not deploy in a crash.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
UNKNOWN	「Acadia」	2008-2013	2
		TOTAL	2