

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3376	DATE	June 23, 2014
MANUFACTURER	Mazda Motor Corporation		
DESCRIPTION OF DEFECT	In the inflator for passenger seat air bag, due to inappropriate molding process and/or handling to prevent moisture absorption of the inflator after molding, the propellant with insufficient density may be installed. Therefore, the inner pressure of the inflator may abnormally rise at the time of air bag deployment, and it may potentially cause a rupture and flying apart of inflator case, or result in catching fire and injure the passenger.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
LA-SE3P	Mazda 「RX-8」	2003	86
LA-GG3P UA-GG3P	Mazda 「ATENZA」	2002-2003	1,178
LA-GG3S UA-GG3S		2002-2003	3,526
LA-GY3W UA-GY3W		2002-2003	5,198
LA-GGEP UA-GGEP		2002-2003	1,014
LA-GGES UA-GGES		2002-2003	353
LA-GYEW UA-GYEW		2002-2003	477
		Total	