

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicle

CAMPAIGN No.	3411	DATE	August 11, 2014
MANUFACTURER	KOBELCO CRANES CO.,LTD		
DESCRIPTION OF DEFECT	<p>For fixing bracket of hydraulic plumbing for power transmission</p> <p>① There may be cracking due to inadequate shape of the bracket. The bracket would be cracked caused by stress of hydraulic pulsation and then make an abnormal noise. Continuously being used under this condition, it may cause the damage on the plumbing and ultimately the oil leakage would happen.</p> <p>② There exists inadequate control for anti-looseness of the bolt for the bracket fixing to frame. There is possibility to get loose the bolt and the bolt would fall out of the bracket. Continuously being used under this condition, it may cause the damage on the plumbing and ultimately the oil leakage would happen.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
UDS-EE04	RK250-8	2013-2014	53 units
TOTAL			53