

## VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-2100	DATE	October 16. 2014
MANUFACTURER	THAI HONDA MFG.CO.,LTD.		
DESCRIPTION OF DEFECT	Resin brackets in fuel pumps are made of material not suitable for them, and those brackets immersed in the test oil, which is used during the course of the manufacture, for a longer period of time than usual may be swollen, and thus they can interfere with the impeller whilst in use. Continued use in such a condition would increase resistance in the interfering area and, if the worse came to the worst, abrasion particles generated from the interfering area could be trapped between the bracket and the impeller whereby the fuel pump would be stopped, causing the engine to stall and refuse to restart.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
JBK-MF12	FORZA Si	2013~2014	4,328
		TOTAL	4,328