

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3448	DATE	Oct.15.2014
MANUFACTURER	TOYOTA		
DESCRIPTION OF DEFECT	<p>#1 In the fuel delivery pipe assembly assembled to the engine on the subject vehicles, due to improper smoothness of the joint surface where the fuel pressure sensor is installed, some fuel delivery pipe assemblies could have insufficient fastening force of the fuel pressure sensor even though the sensor was tightened with the specified torque. In this condition, the fastening of the sensor could become loose, which could result in fuel leakage.</p> <p>#2 In the brake master cylinder of the subject vehicles, due to improper shape of the seal groove, the sealing lip of the rubber seal ring could become damaged when the ring is pushed hard against the groove. In this condition, the crack could expand from the damage on the lip leading to illumination of the brake warning lamp, which may result in brake force becoming decreased.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
DAA-UVF45	[LS600h]	2007-2010	8,374	#1
DAA-UVF46	[LS600hL]	2007-2010	4,685	
DBA-USF40	[LS460]	2007-2010	11,284	
DBA-USF45		2008-2010	287	
DBA-USF41	[LS460L]	2008-2010	430	
DBA-USF46		2008-2010	56	

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
DBA-URS190	[GS460]	2007-2010	808	#1
DAA-GWS191	[GS450h]	2006-2010	5,708	
DBA-GRS191	[GS350]	2007-2010	5,208	
DBA-GRS196		2007-2010	582	
DBA-USE20	[IS F]	2007-2010	2,223	
DBA-GSE21	[IS350]	2007-2010	2,112	
	[IS350C]	2010	4	
DBA-GSE20	[IS250]	2007-2010	13,095	
	[IS250C]	2009-2010	1,607	
DBA-GSE25	[IS250]	2007-2010	1,140	
DBA-URS206	[CROWN MAJESTA]	2009-2010	4,204	
DBA-GRS180	[CROWN]	2007-2010	9,297	
DBA-GRS181		2007-2010	1,327	
DBA-GRS182		2007-2010	3,963	
DBA-GRS183		2007-2008	357	
DBA-GRS184		2007-2008	1,477	
DAA-GWS204		2008-2010	17,274	

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
DBA-GRX120	[MARK X]	2007-2009	29,224	#1
DBA-GRX121		2007-2009	1,701	
DBA-GRX125		2007-2009	3,238	
DBA-GRX130		2009-2010	26,289	
DBA-GRX133		2009-2010	1,350	
DBA-GRX135		2009-2010	2,311	
DBA-GRS200	[CROWN]	2008-2010	45,195	#1,2
DBA-GRS201		2008-2010	3,993	
DBA-GRS202		2008-2010	19,272	
DBA-GRS203		2008-2010	2,646	
DBA-GRS204		2008-2010	13,432	
DBA-UZS207	[CROWN MAJESTA]	2009-2012	947	#2
DBA-GRS200	[CROWN]	2010-2012	29,567	
DBA-GRS201		2010-2012	2,757	
DBA-GRS202		2010-2012	5,357	
DBA-GRS203		2010-2012	1,171	
DBA-GRS204		2010-2012	2,751	
DBA-ZRR70G DBA-ZRR70W	[NOAH] [VOXY]	2007-2012	486,505	

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
DBA-ZRR75G	[NOAH]	2007-2012	90,702	#2
DBA-ZRR75W	[VOXY]			
		TOTAL	863,910	

#1 244,153

#2 704,295

(included number) #1+#2 84,538

[Note] Vehicles involved in the recall on fuel pressure sensor due to the other cause in 2011 are included in this recall.