

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic ~~Import Vehicles~~

CAMPAIGN No.	Gai-2115	DATE	Dec 4, 2014
MANUFACTURE	General Motors Company (Japanese Importer : General Motors Japan Ltd.)		
DESCRIPTION OF DEFECT	<p>General Motors has decided that a defect which relates to motor vehicle safety may exist in the following vehicles repaired under recall 12180: 2006 model year Chevrolet Trailblazer EXT and 2006-2007 Chevrolet Trailblazer. The service bulletin provided that if the driver's door module was functioning properly, a protective coating was to be applied. If the module was not working properly, it should be replaced. Vehicles that were repaired by having a protective coating applied to the driver's door module may continue to have a safety related defect.</p> <p>If fluid, such as melted snow containing road salt, enters the driver's door module, it may cause corrosion that could result in a short in the circuit board. A short may cause the power door lock and power window switches to function intermittently or may stop working. A short may cause overheating, which could melt components of the door module, producing odor, smoke, or a fire. Additionally, the windows may raise or lower themselves, without user input. These conditions may occur even with the vehicle parked and the key removed. Customers should park the vehicle outdoors until it has been remedied.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
GH-T360 GH-T360G GH-T370L GH-T370V	「Trailblazer」	2006 – 2007	352
		TOTAL	352