

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN No.	3539	DATE	Mar.31.2015
MANUFACTURER	Hino Motors, Ltd.		
DESCRIPTION OF DEFECT	On certain heavy duty buses, due to the insufficient strength of a bracket of an EGR (Exhaust Gas Recirculation) pipe installed in the engine, there are some a crack is generated into the bracket resonates in a specific engine rotation region. If the vehicle is operated under the condition continuously, the crack of the bracket progresses and the fixing bracket breaks, causing an EGR pipe to crack, which may result in a leak of exhaust gas. In the worst case, there is a possibility that a part of floor is damaged by exhaust gas, or some of air intake hoses may melt and lack of power.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
LJG-HU8JLGP	[HINO Blue Ribbon City]	2010~2015	171
LNG-HU8JLGP			
HU8J			
LJG-HU8JMGP	[HINO SELEGA]	2010~2015	141
LNG-HU8JMGP			
LDG-RU8JHBA	[HINO SELEGA]	2010~2015	225
SDG-RU8JHBA			
		TOTAL	537