

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3531	DATE	April 16,2015
MANUFACTURER	MITSUBISHI MOTORS CORPORATION		
DESCRIPTION OF DEFECT	<p>① Due to inappropriate manufacturing process for the electrical parts inside the ETACS ECU which controls the operation of the head lights and the windshield wiper etc., the electrical resistance for the electrical parts may increase. As a result, the voltage inside the ECU may become unstable, and in the worst case scenario, the head lights may be turned off when they are lit and/or the windshield wiper may become inoperable due to malfunction of the ETACS ECU.</p> <p>② Due to inappropriate manufacturing process for the blower motor, the shaft and the bearing inside the motor may be worn out abnormally when the shaft and the bearing are assembled without proper centering process. As a result, if use continues under the condition, the shaft and the bearing may be stuck and in the worst case scenario, the driver cannot keep the eyesight safely due to the malfunction of the defroster caused by the stoppage of the blower motor.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-CV4W	「DELICA」	2009~2010	4,711
DBA-CV5W		2009~2010	27,181
DBA-CW4W	「OUTLANDER」	2010	1,333
		2009~2010	2,910
DBA-CW5W		2010	1,059
		2009~2010	9,153
DBA-CW6W		2009	235
DBA-CY3A	「GALANT」	2009~2010	1,921
DBA-CY4A		2009	1,984
CBA-CY4A		2009~2010	592
DBA-CX3A		2009~2010	1,007
DBA-CX4A		2009	1,541
CBA-CX4A		2009~2010	806
CBA-CZ4A		「LANCER EVOLUTION」	2009~2010
DBA-GA3W	「RVR」	2010	14,701
		2009~2010	71,053

The parts for which the vehicle can not be identified because it was shipped as service parts (①)

Part Name	Part No.	Shipment Period of the part	Quantity
ETACS ECU	8637A312	2009~2010	31
	8637A312AZ	2009~2010	12
	8637A313AZ	2009	1
	8637A319	2009	13
	8637A319AZ	2009	11
	8637A320	2009~2010	278
	8637A320AZ	2009	63
	8637A321	2009~2010	318
	8637A321AZ	2009~2010	147
	8637A393	2009	1
	8637A393AZ	2009	2
	8637A322	2009~2010	75
	8637A322AZ	2009~2010	26

The parts for which the vehicle can not be identified because it was shipped as service parts (②)

Part Name	Part No.	Shipment Period of the part from supplier	Quantity
Blower motor	CSA431D221	2009~2011	1,576