

## Vehicle Safety/Pollution Recall Campaign in Japan

Import Vehicles

Campaign No.	Gai – 2159	Date	March. 6, 2015
Manufacturer	Jaguar Land Rover Limited ( Japanese Importer : Jaguar Land Rover Japan Limited )		
Description of defect	<p>Jaguar Land Rover received through its Electronic Product Quality Reporting (EPQR) dealer field reporting system a report of a vehicle exhibiting multiple warning lights on the instrument cluster followed by heavy steering. Another EPQR was received where a burning smell was reported followed by the Climate Controls system controls not working.</p> <p>Upon investigation it was identified that a change to the blower motor wire specification by the supplier of the cockpit harness had taken place on Right Hand Drive harnesses. The specification of the ground wire for the air conditioning blower within the cockpit harness should be 4.0mm<sup>2</sup> the supplier had used wire with a cross sectional area of 0.5mm<sup>2</sup>.</p> <p>Ground wires not to the correct specification may, during normal vehicle usage overheat and melt the plastic insulation protecting the wire. This can lead to a number of effects, the most serious being interior passenger cabin vehicle fire. Certain wires within the wiring loom carry a permanent 12V feed which, should damage occur, could lead to an unattended vehicle fire.</p>		

Type	Commercial name	Model year recalled	Number of vehicles
ABA-LG3SB	「Range Rover」	2015	10
ABA-LGL3SC		2015	3
ABA-LG5SA		2015	8
ABA-LGL5SC		2015	2
ABA-LW3SA	「Range Rover Sport」	2015	34
ABA-LW5SA		2015	11
		Total	68