

# VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/~~Import~~ Vehicles

CAMPAIGN No.	3 6 0 2	DATE	June 29, 2015
MANUFACTURER	ISEKI & CO., LTD.		
DESCRIPTION OF DEFECT	<p>For engines of agricultural tractors,</p> <p>(1) At manufacturing process, fastening torque of nut was not uniform for flare nut part of turbo charger lubricant oil pipe. Therefore in some cases, fastening torque was not enough. Such cases can, if continued using the vehicle, result nut loosening and engine oil leak.</p> <p>(2) At manufacturing process, oil filter assembling was inappropriate, therefore O-ring may not be assembled properly. Such cases can result lack of adhesion at oil filter surface, thus engine oil may leak.</p> <p>(3) At manufacturing process of fastening oil sump drain bolt, fastening torque was not checked properly. Therefore in some cases fastening torque was not enough. Such cases can result bolt loosening due to vibration caused by vehicle operation, and if continued using the vehicle, it can result bolt falling out thus engine oil leak.</p>		
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
WDR-T216F	「TJV983」	2014-2015	93
WDR-T217F	「TJV883」	2014-2015	55
	「MF4509」	2014	1
WDR-T218F	「TJV783」	2014-2015	85
WDR-T219F	「TJV703」	2014-2015	44
	「MF4507」	2015	1
WDR-T220F	「TJV623」	2014-2015	32
	「MF4506」	2014-2015	3
		TOTAL	314