

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / ~~Import~~ Vehicles

CAMPAIGN No.	3584	DATE	June12, 2015
MANUFACTURE	TOYOTA INDUSTRIES CORPORATION		
DESCRIPTION OF DEFECT	<p>①At the parking rod of the subject vehicle, due to insufficient thread locking treatment, the nut, which is located at mounting portion for connecting the parking rod and lever, may be loosened, when the transmission is operated repeatedly. If the vehicle is used continuously as it is, the nut comes off. In the worst case, the nut is biting into gears and wheels could be locked.</p> <p>②At the actuator shaft of the subject vehicle, due to inappropriate connection structure between the actuator shaft and parking lever, spring pin may be slipped off gradually, when the transmission is in on-and-off operation. If the vehicle is used continuously as it is, the spring pin come off. In the worst case, the pin is biting into gears and wheels could be locked.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
AA89	None	2013	1
AA89		2014	10
		TOTAL	11