

CHILD RESTRAINT SYSTEM SAFETY RECALL CAMPAIGN IN JAPAN

(Domestic) Import Items

CAMPAIGN No.	SOUGAI-8	DATE	August 31, 2015
MANUFACTURER	Combi Corporation		
DESCRIPTION OF DEFECT	<p>In the equipment to assist a child to ride vehicles (child seat),</p> <ol style="list-style-type: none"> 1. There is a fault engagement in attachment portion of waist belt and crotch belt due to the improper manufacturing management. Therefore, the belt might detach and might not be able to securely restrain the occupant in the event of the collision. 2. Because the tolerance of dimension between rod collar and operating switch (stopper) attached to rotate operation lever is not taken into account, the two parts may contact one another, thus interfere and prevent the rotate operation lever from returning to the original position. Therefore, the lock mechanism to fix the rotation of a child seat might not operate, and the child seat rotation might not be fixed. 		

COMMERCIAL NAME	TYPE	CLASSIFICATION	MODEL YEAR RECALLED	NUMBER OF ITEMS
NEROOM/ NESERUTURN	CB-UTC	Groups G0+/ I	(Serial number) 20010-00-002112 to 20010-00-102227 (Scope of production) 21 Oct. 2013 to 27 Feb. 2015	1. 94,210 2. 67,050
RECARO Start X	CB-UTC	Groups G0+/ I	(Serial number) 20010-00-035415 to 20010-00-059326 (Scope of production) 10 Mar. 2014 to 3 Jun. 2014	1. 3,936 2. 3,936
NEROOM/ NESERUTURN ISOFIX	CC-UID	Groups G0+/ I	(Serial number) 20011-00-002018 to 20011-00-012681 (Scope of production) 1 Apr. 2014 to 13 Feb. 2015	1. 9,860 2. 5,271
mamalon	CB-ELC	Groups G0/ I / II	(Serial number) 20012-00-002017 to 20012-00-014204 (Scope of production) 9 Jun. 2014 to 24 Jul. 2015	1. 11,891
TOTAL				1. 119,897pcs. 2. 76,257pcs.