

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-2250	DATE	October. 15. 2015
MANUFACTURER	HONDA OF AMERICA MFG., INC.		
DESCRIPTION OF DEFECT	<p>With regard to the dual combined brake system, which has the function to activate front and rear brakes by linking them together, the second master cylinder, which transmits braking force from the front wheel to the rear wheel upon application of the brake, has structural inadequacies. Because of this, the oil passage for releasing the brake's fluid pressure may be clogged with compounds formed as the result of reaction of zinc compounds eluted from the brake hose with brake fluid components. This may cause the rear brake to drag and continued riding with the rear brake dragged can overheat the rear brake, and as a consequence the rear brake could catch fire in the very worst case.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
BC-SC47	「GOLD WING」	2001	570
		2002~2003	650
		2004	50
		2005	80
EBL-SC47		2006	444
		2007	313
		2008	242
		2009	151
		TOTAL	2,500