

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	GAI-2253	DATE	November 5, 2015
MANUFACTURER	MASERATI S.p.A. (Japanese Importer: Maserati Japan Ltd.)		
DESCRIPTION OF DEFECT	<p>The protective sealing cover on the electrical connection of the engine power cable to the starter motor is potentially installed in a wrong way. Moreover the engine power cable could be not properly secured. During the normal use of the vehicle, the engine power cable is subjected to vibrations. Without the protective sealing cover in its proper position and without a proper securing of engine power cable, the connection end may become progressively loose and potentially contact the engine block assembly.</p> <p>This issue could lead to engine power cable damage and several electrical problems such as no vehicle start and vehicle battery drain conditions. This can also include, in the most severe cases, an engine compartment fire, potential for engine stalling and increasing the risk of a crash.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
ABA-MQP38A	「Quattroporte」	2013 – 2014	196
		TOTAL	196