

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic ~~Import~~ Vehicles

CAMPAIGN No.	3720	DATE	14 Dec 2015
MANUFACTURER	Kawasaki Heavy Industries, Ltd.		
DESCRIPTION OF DEFECT	<p>① Improper routing design of electrical wires causes the leads to contact with frame edge. If it is continuously used, the outer insulation of leads may be worn, causing the core wires to short-circuit to the frame edge. This results in engine stall in the worst case.</p> <p>② The throttle body holder may harden by engine heat because its heat resistance is insufficient. If it is continuously used, the throttle body holder may be cracked and additional air may flow into the engine. This results in unstable engine running, or engine stall in the worst case.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	Notes
EBL-EJ800A	W800	2011~2013	3,629	①②
		2013~2016	2,344	①
		TOTAL	5,973	