

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	3712	DATE	December 11.2015
MANUFACTURER	YANMAR CO.,LTD.		
DESCRIPTION OF DEFECT	<p>① Deformation of stopper stay of brake pedal When depress brake pedal and release the brake pedal, the brake pedal returns original position by spring force. Due to insufficient strength of stopper stay, the stopper stay will deform after repeat brake pedal operation. If the brake pedal deforms, hole alignment between right brake pedal and left brake pedal will be out of order. In this case, the connecting pin will not go through holes between right brake pedal and left brake pedal. This means that right brake pedal and left brake pedal cannot connect.</p> <p>② The cylinder cap structure of the power steering cylinder is improper. Because of it, the lock ring of the cylinder cap damages and there is possibility that a cylinder cap is omitted. When the worst, there is a fear that the steering operation becomes impossible with the oil leak.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
—	YT490	2015	①122 ②108
	YT5101	2015	①25
	YT5113	2015	①112
			TOTAL 258