

## VEHICLE SAFETY/ POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3713	DATE	December 8, 2015
MANUFACTURER	Komatsu Ltd.		
DESCRIPTION OF DEFECT	<p>The hydrostatic continuously variable transmission of shovel loader (Hereinafter referred to as "HST"), since the oil seal structure of a hydraulic pump is inappropriate, the internal pressure of the pump is increased immediately after the engine start, its oil seal may be deformed. Therefore, sealing performance is impaired by the wear of the seal, oil leaks to the flywheel housing. Then, if it continued use, the temperature of the oil leaked into the flywheel housing will be higher. And the worst case, the flywheel damper is melting, may become impossible travel.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
KDP-WA115	WA100-6	2010-2014	2653
WDP-WA124	WA100-7	2013-2015	1643
TOTAL			4296