

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3728	DATE	Jan.14, 2016
MANUFACTURER	SUZUKI MOTOR CORPORATION		
DESCRIPTION OF DEFECT	<p>Due to improper moisture control at the production of Power module (Circuit board) in Regulate Rectifier, Power module is detached from Regulate Rectifier body with cooling fins and the temperature of regulating device in Power module is over its heat resistance temperature.</p> <p>If continued to use with this condition, this can cause discharge of the battery. In the worst case, it can lead to engine stalling during running and be impossible to restart.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
JBK-CJ47A	JENMA	2008	4,759
BC-GK7DA	GSR400	2007	1,100
EBL-GK7EA		2009~2010	1,360
EBL-GW72A	BANDIT 1250	2007~2010	1,130
EBL-VK58A	GLADIUS	2010~2012	2,081
BC-VK54A	INTRUDER	2007~2008	1,418
EBL-VK56A		2009~2010	1,462
TOTAL			13,310