

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	Gai-2300	DATE	Feb.24, 2016
MANUFACTURER	SUZUKI MOTOR CORPORATION (Japanese Importer : ITOCHU Automobile Corporation)		
DESCRIPTION OF DEFECT	<p>① Due to inappropriate coupler shape that connects a wire harness to ignition switch lead wire, coupler terminals may be corroded by splashed water. With Continued use in this condition, the corrosion may progress on terminals causing disconnection of electrical supply, and in the worst case can cause the engine to stall.</p> <p>② Due to inappropriate routing of wiring harness, it may touch to bottom of fuel tank. With continued use in this condition, wiring harness insulation may cause wearing then lead to short-circuit by vehicle vibration, and engine would not operate normally. In the worst case can cause the engine to stall.</p> <p>③ Due to inappropriate fixing position of battery minus earth terminal for engine, it may cause poor electric continuity. With continued use in this condition, the starter motor would not operate properly, and in the worst case engine would not start</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DD111	V-Strom 1000	2014	60
		2015	10
		TOTAL	70