

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-2301	DATE	February 18,2016
MANUFACTURER	Mitsubishi Motors(Thailand)Co., Ltd.		
DESCRIPTION OF DEFECT	In the turn light switch, the terminal for the connector may become worn by the operation of the switch generating the insulating material by the oxidization of the worn dust due to insufficient rigidity of the portion where the switch lever is installed. As a result, if use continues under the condition, it could cause conduction failure by the insulating material biting on the terminal resulting in head lamp, small lamp, front fog lamp, tail lamp, number plate lamp and room lamp connected with the subject switch to become unlit or blinking and also the direction indicator lamp to become unlit.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ABF-KB9T	「TRITON」	2006～2010	1,400
		2006～2010	1,400