## VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

## Domestic Vehicles

CAMPAIGN No.	3790	DATE	April 14,2016		
MANUFACTURER	MITSUBISHI	MITSUBISHI MOTORS CORPORATION			
DESCRIPTION OF DEFECT	<ul> <li>turbo chan significant and high i the fuel i condition, exhaust m</li> <li>2 In the ECI turbo chan detection of gas to becco of the know condition, exhaust m</li> <li>3 The radiar connection to inapprovinsufficien increase in</li> </ul>	rger, the temperature of high when driven are loading condition due njection volume. As a the exhaust gas may anifold caused by the h U control program for the rger, the ignition timin of the knocking causin ome significantly high of coking control data. As the exhaust gas may anifold caused by the h tor fan motor may sto caused by the brush to priate material of the t performance of air co	the engine for the vehicle with the ng may be delayed by the wrong g the temperature of the exhaust due to inappropriate configuration a result, if use continues at the y leak due to the crack of the neat fatigue. Op its operation by the improper o absorb moisture and bloated due brush. As a result, it may cause onditioner and/or the temperature use continues at the condition, it		

ТҮРЕ	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
TA-H53A	「PAJERO MINI」	$2002 \sim 2005$	1,703
TA-H58A		$2002 \sim 2005$	26,233
ABA-H53A		$2005 \sim 2012$	7,147
ABA-H58A		$2005 \sim 2012$	57,312
EBD-U61V	「MINICAB」	$2011 \sim 2013$	965
EBD-U62V		$2011 \sim 2013$	1,269
TA-U61W	「TOWNBOX」	$2002 \sim 2004$	1,374
ABA-U61W		$2004 \sim 2011$	4,103
TA-U62W		$2002 \sim 2004$	1,538
ABA-U62W		$2004 \sim 2011$	3,903
ABA-H59A	$\lceil \text{KIX}  floor$	$2008 \sim 2012$	11,300
EBD-U71V	「CLIPPER」	$2012 \sim 2013$	1,693
EBD-U72V		$2012 \sim 2013$	865
ABA-U71W	CLIPPER RIO	$2007 \sim 2011$	3,468
ABA-U72W		$2007 \sim 2012$	1,546
		TOTAL	124,419

Number of vehicles in which the service part is installed (3)

ТҮРЕ	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
TA-H53A	「PAJERO MINI」	$2001 \sim 2005$	15
TA-H58A		2000~2005	71
		TOTAL	86

The parts for which the vehicle can not be identified because it was shipped as service parts (3)

Part Name	Part No.	Delivery Period of the part	Quantity
MOTOR	MR481597	$2005 \sim 2015$	508
MOTOR	MR597481	$2005 \sim 2015$	1,710
RADIATOR FAN KIT	MR988368	$2005 \sim 2014$	215