

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3 8 2 1	DATE	June.9.2016
MANUFACTURER	N I S S A N		
DESCRIPTION OF DEFECT	<p>In the left side engine mount of the engine with supercharger, because the processing of the screw hole for the fixing bolt of the bracket was inappropriate, there are screw holes which double threading might be made. Therefore, the fixing bolt may come loose by vibration such as the driving force of the CVT, if the vehicle continues to be driven in this condition, the bolt may break and engine inclines. In an extreme case, the drive shaft may come out of the transmission, and the vehicle cannot be driven.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
DBA-E12	NOTE	2012~2015	229,293
		TOTAL	229,293