

# VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN NO.	3842	DATE	June 30 ,2016
MANUFACTURER	ISUZU MOTORS LIMITED		
DESCRIPTION OF DEFECT	<p>On certain heavy and medium duty buses, as the strength of the welding part of the internal arm and the shaft which operates the variable nozzles of the engine turbocharger is insufficient, the welding part concerned may be twisted by the drive of the actuator, which may cause the variable nozzles to move a little. Therefore there is a possibility that the intake air amount becomes insufficient, causing the engine output to decline and the engine speed to be unstable, resulting the engine to stall while driving and the vehicle unable to restart in the worst case.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
LDG-RU8JHBJ SDG-RU8JHBJ	[ISUZU GALA]	2010-2011	37
SDG-RR7JJCJ	[ISUZU GALA MIO]	2011	18
		TOTAL	55