

VEHICLE SAFETY/ POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicle

CAMPAIGN No.	3874	DATE	Aug 4,2016
MANUFACTURER	TADANO LTD.		
DESCRIPTION OF DEFECT	Due to inadequate steering stopper position adjustment of the 3 <sup>rd</sup> axle steering mechanism on wheel cranes, when steered to maximum stroke, there are cases where deflection of the axle loosens the upper torque rod installation bolt and results in bolt breakage. This also results in an irregular sound when the upper torque rod comes loose and, after continued usage in this condition, may damage the suspension cylinder installation, in worst cases resulting in an inability to travel.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
UDS-T011	TADANO 「GR-500N-2」	2015-2016	176
		TOTAL	176