

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	3886	DATE	August 31.2016
MANUFACTURER	YANMAR CO.,LTD.		
DESCRIPTION OF DEFECT	<p>① The bracket to fix Exhaust pipe to Engine in some units has poor strength due to the inappropriate shape, especially in high rpm of Engine. Therefore, Engine vibration makes the pipe swung, which causes a damage at the installed portion of the bracket or pipe by excessively high stress. In the worst case, there is a possibility that the exhaust gas leaks after the pipe is cracked.</p> <p>② The bracket to fix Exhaust pipe to Engine in some units was installed in the conditions of mis-alignment between the hole of the pipe and that of the bracket. Therefore, Engine vibration makes the pipe swung, which causes a damage at the installed portion of the bracket or pipe by high stress. In the worst case, there is a possibility that the exhaust gas leaks after the pipe is cracked.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
—	「YT490」	2015—2016	294
	「YT5101」	2015—2016	52
	「YT5113」	2015—2016	279
—	「YT5113」	2015—2016	73
—	「YT463」	2015—2016	198
	「YT470」	2015—2016	246
TOTAL			1142