

## VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-2375	DATE	September.8. 2016
MANUFACTURER	THAI HONDA MFG.CO.,LTD.		
DESCRIPTION OF DEFECT	<p>Because suitable materials were not used for plastic inlet covers in fuel pumps, any inlet cover dipped in the test oil, which was used at a stage in the process of manufacture, for hours may expand and interfere with the impeller whilst in use, and as a consequence increase of resistance and abrasion can occur in such an interfering area. Should particles of abrasion get caught between the inlet cover and the impeller, the fuel pump could stop and cause the engine to stall and refuse to restart in the very worst case.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
JBK-MF12	FORZA Si	2013~2015	5,176
		TOTAL	5,176